


Räumdorne Nutenbreite 5 mm

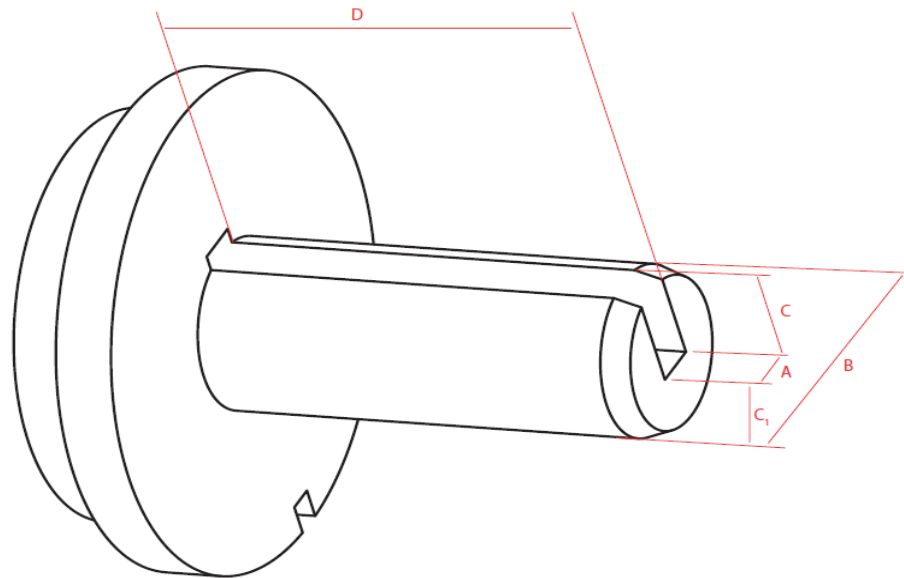

Nummer	Nutenbreite A	Durchmesser B	Dorn-Nutentiefe C	Hilfsmaß Werkzeughöhe C ₁	Dornlänge D
DR05 - 10	5 mm	11 mm	6,85 mm	3,8 mm	88,85 mm
DR05 - 13	5 mm	12 mm	6,9 mm	4,85 mm	100 mm
DR05 - 07	5 mm	12 mm	7 mm	5 mm	48,9 mm
DR05 - 09	5 mm	12 mm	9 mm	3 mm	51 mm
DR05 - 02	5 mm	12 mm	9,5 mm	2 mm	36 mm
DR05 - 05	5,3 mm	13,7 mm	10 mm	3,5 mm	110 mm
DR05 - 12	5 mm	14 mm	8,3 mm	5 mm	100 mm
DR05 - 03	5 mm	14 mm	8,7 mm	5 mm	90 mm
DR05 - 16	5 mm	14 mm	8,85 mm	5 mm	52 mm
DR05 - 06	5 mm	14 mm	9,8 mm	4 mm	154 mm
DR05 - 18	5 mm	15 mm	8,85 mm	6 mm	90 mm
DR05 - 04	5 mm	15,5 mm	8,5 mm	6,5 mm	35 mm
DR05 - 08	5 mm	16 mm	7 mm	8 mm	36 mm
DR05 - 11	5 mm	16 mm	8 mm	7 mm	100 mm
DR05 - 14	5 mm	17 mm	8,5 mm	8 mm	100 mm
DR05 - 15	5 mm	18 mm	9 mm	8,85 mm	25 mm
DR05 - 17	5 mm	20 mm	11 mm	8,5 mm	101,5 mm
DR05 - 19	5 mm	28 mm	10 mm	18 mm	35 mm
DR05 - 01	5 mm	30 mm	9,25 mm	21 mm	67 mm